



DETAIL 1 M 1:10
ASSIGNMENT OF CABLE TRAYS
BETWEEN T80, T81 AND MOTOR
BETWEEN T40 AND T46

- T81-WH02 ① - 3.6 - FEED CABLE T81 N2xSZY 4x3x1400/35
T81-WH02 ② - 3.7 - FEED CABLE T81 N2xSZY 4x3x1400/35
T40-WH01 ⑤ - 3.18 - FEED CABLE T40 AND T46 N2xSZY 6x3x240
T81-WH06 ③ - 3.8 - MOTOR 8.6MW N2xSZY 2x3x1240/25
T81-WH08 ④ - 3.10 - MOTOR 6.7MW N2xSZY 2x3x1240/25

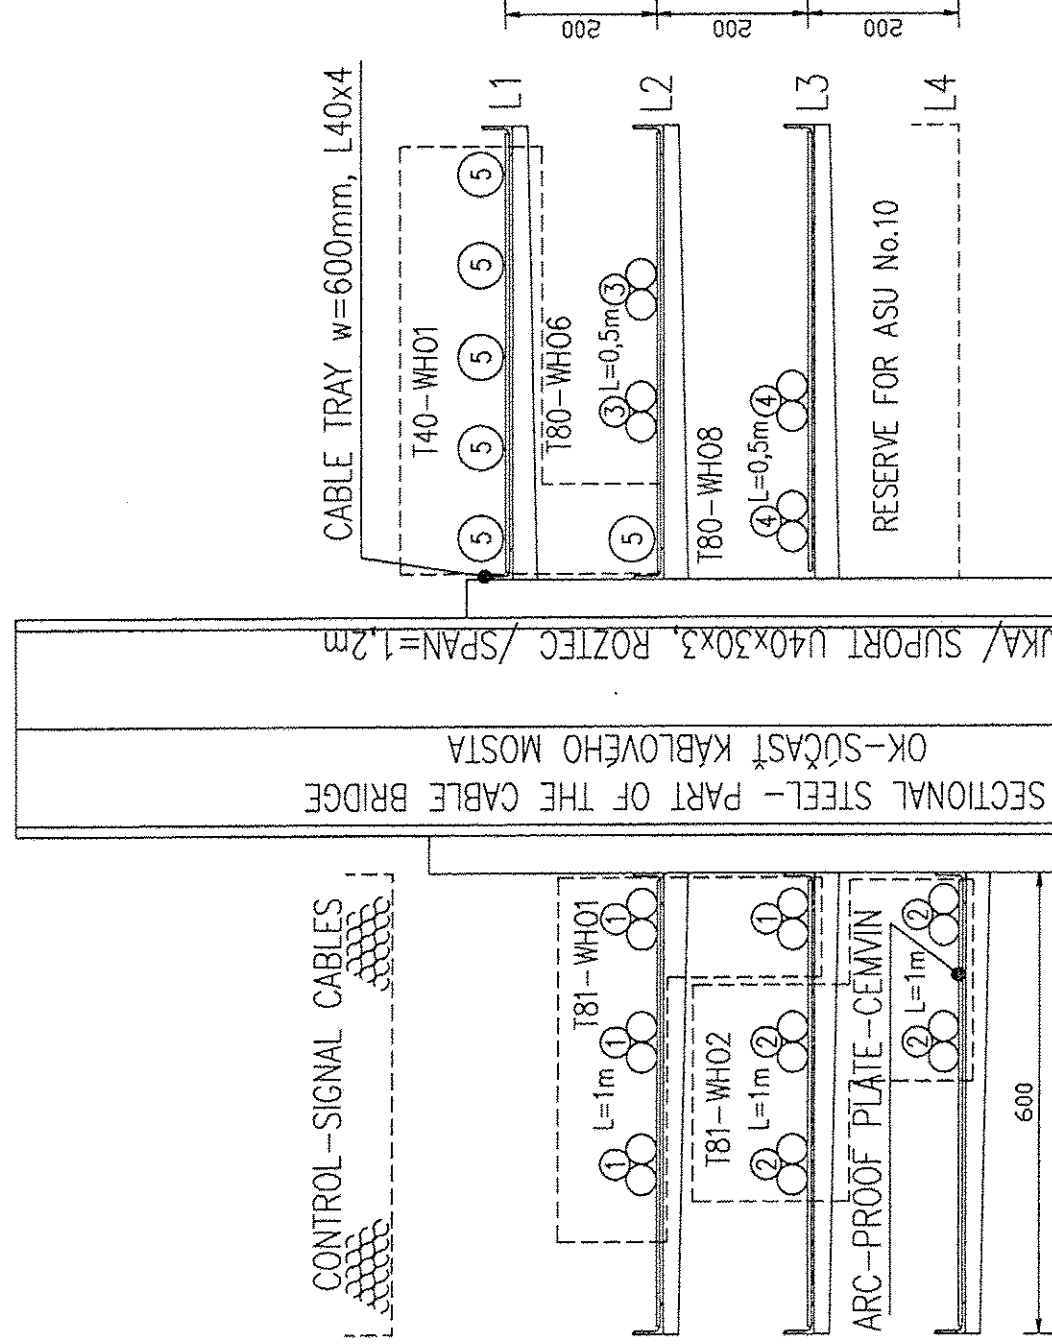



DETAIL 1a M 1:10
ASSIGNMENT OF CABLE TRAYS
BETWEEN T80, T81 AND MOTOR
BETWEEN T40 AND T46

- T81-WH02 ① - 3.6 - FEED CABLE T81 N2xSZY 4x3x1400/35
T81-WH02 ② - 3.7 - FEED CABLE T81 N2xSZY 4x3x1400/35
T40-WH01 ⑤ - 3.18 - FEED CABLE T40 AND T46 N2xSZY 6x3x240
T81-WH06 ③ - 3.8 - MOTOR 8.6MW N2xSZY 2x3x1240/25
T81-WH08 ④ - 3.10 - MOTOR 6.7MW N2xSZY 2x3x1240/25

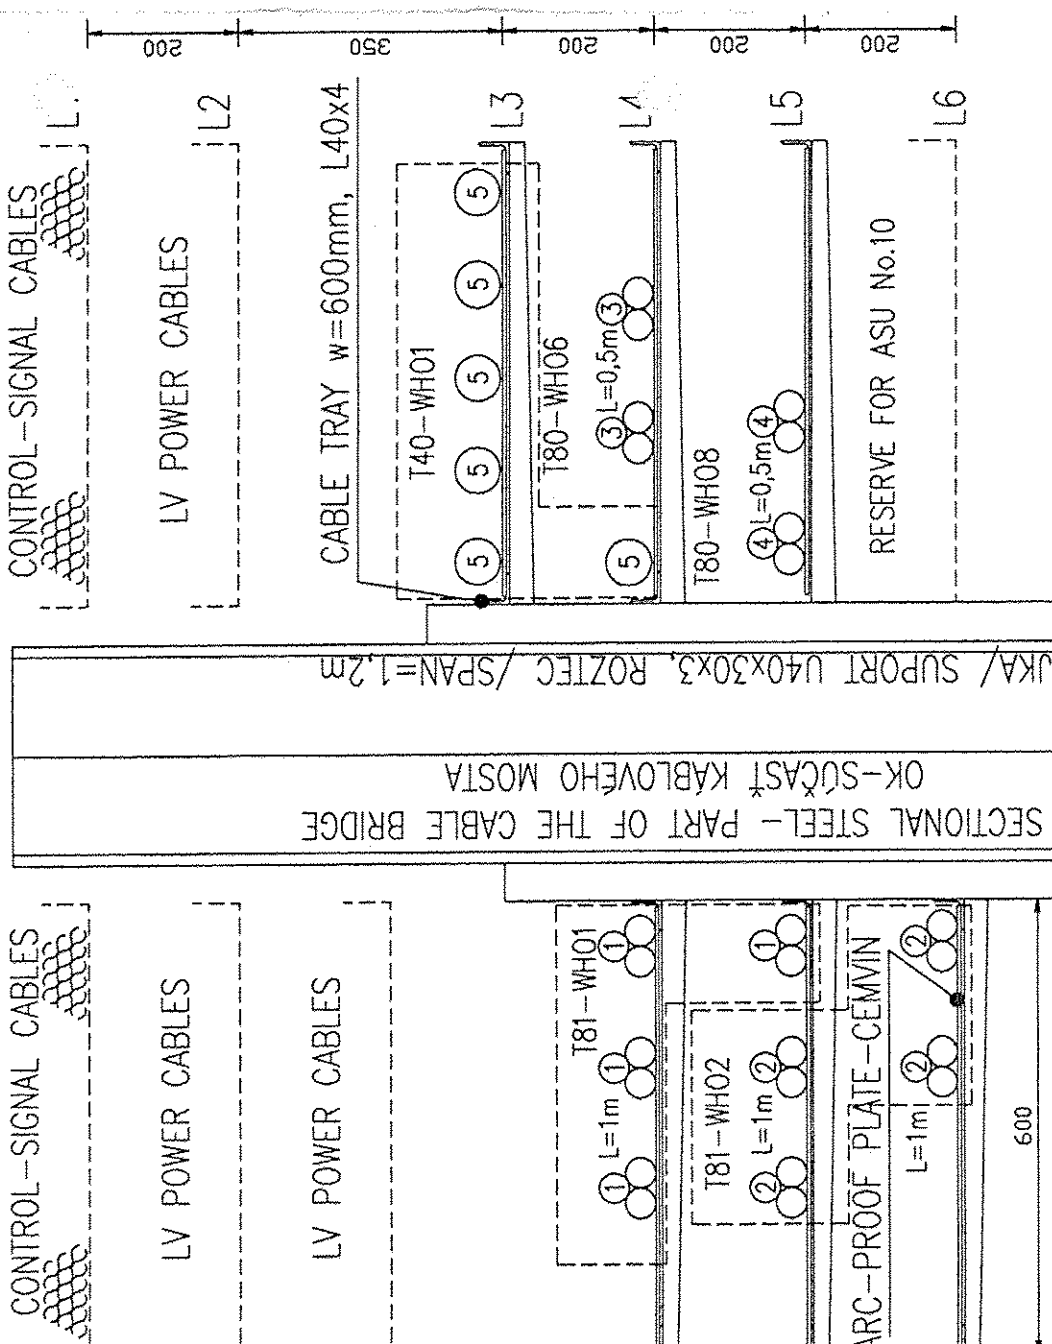


DETAIL 2 M 1:10
ASSIGNMENT OF CABLE TRAYS
BETWEEN T80, T81 AND MOTOR
BETWEEN T40 AND T46

- T81-WH02 ① - 3.6 - FEED CABLE T81 N2xSZY 4x3x1400/35
T81-WH02 ② - 3.7 - FEED CABLE T81 N2xSZY 4x3x1400/35
T40-WH01 ⑤ - 3.18 - FEED CABLE T40 AND T46 N2xSZY 6x3x240
T81-WH05 ⑥ - 3.14 - FEED CABLE M70001 N2xSZY 3x1x120/16
T81-WH07 ⑦ - 3.16 - FEED CABLE M77001 N2xSZY 3x1x120/16

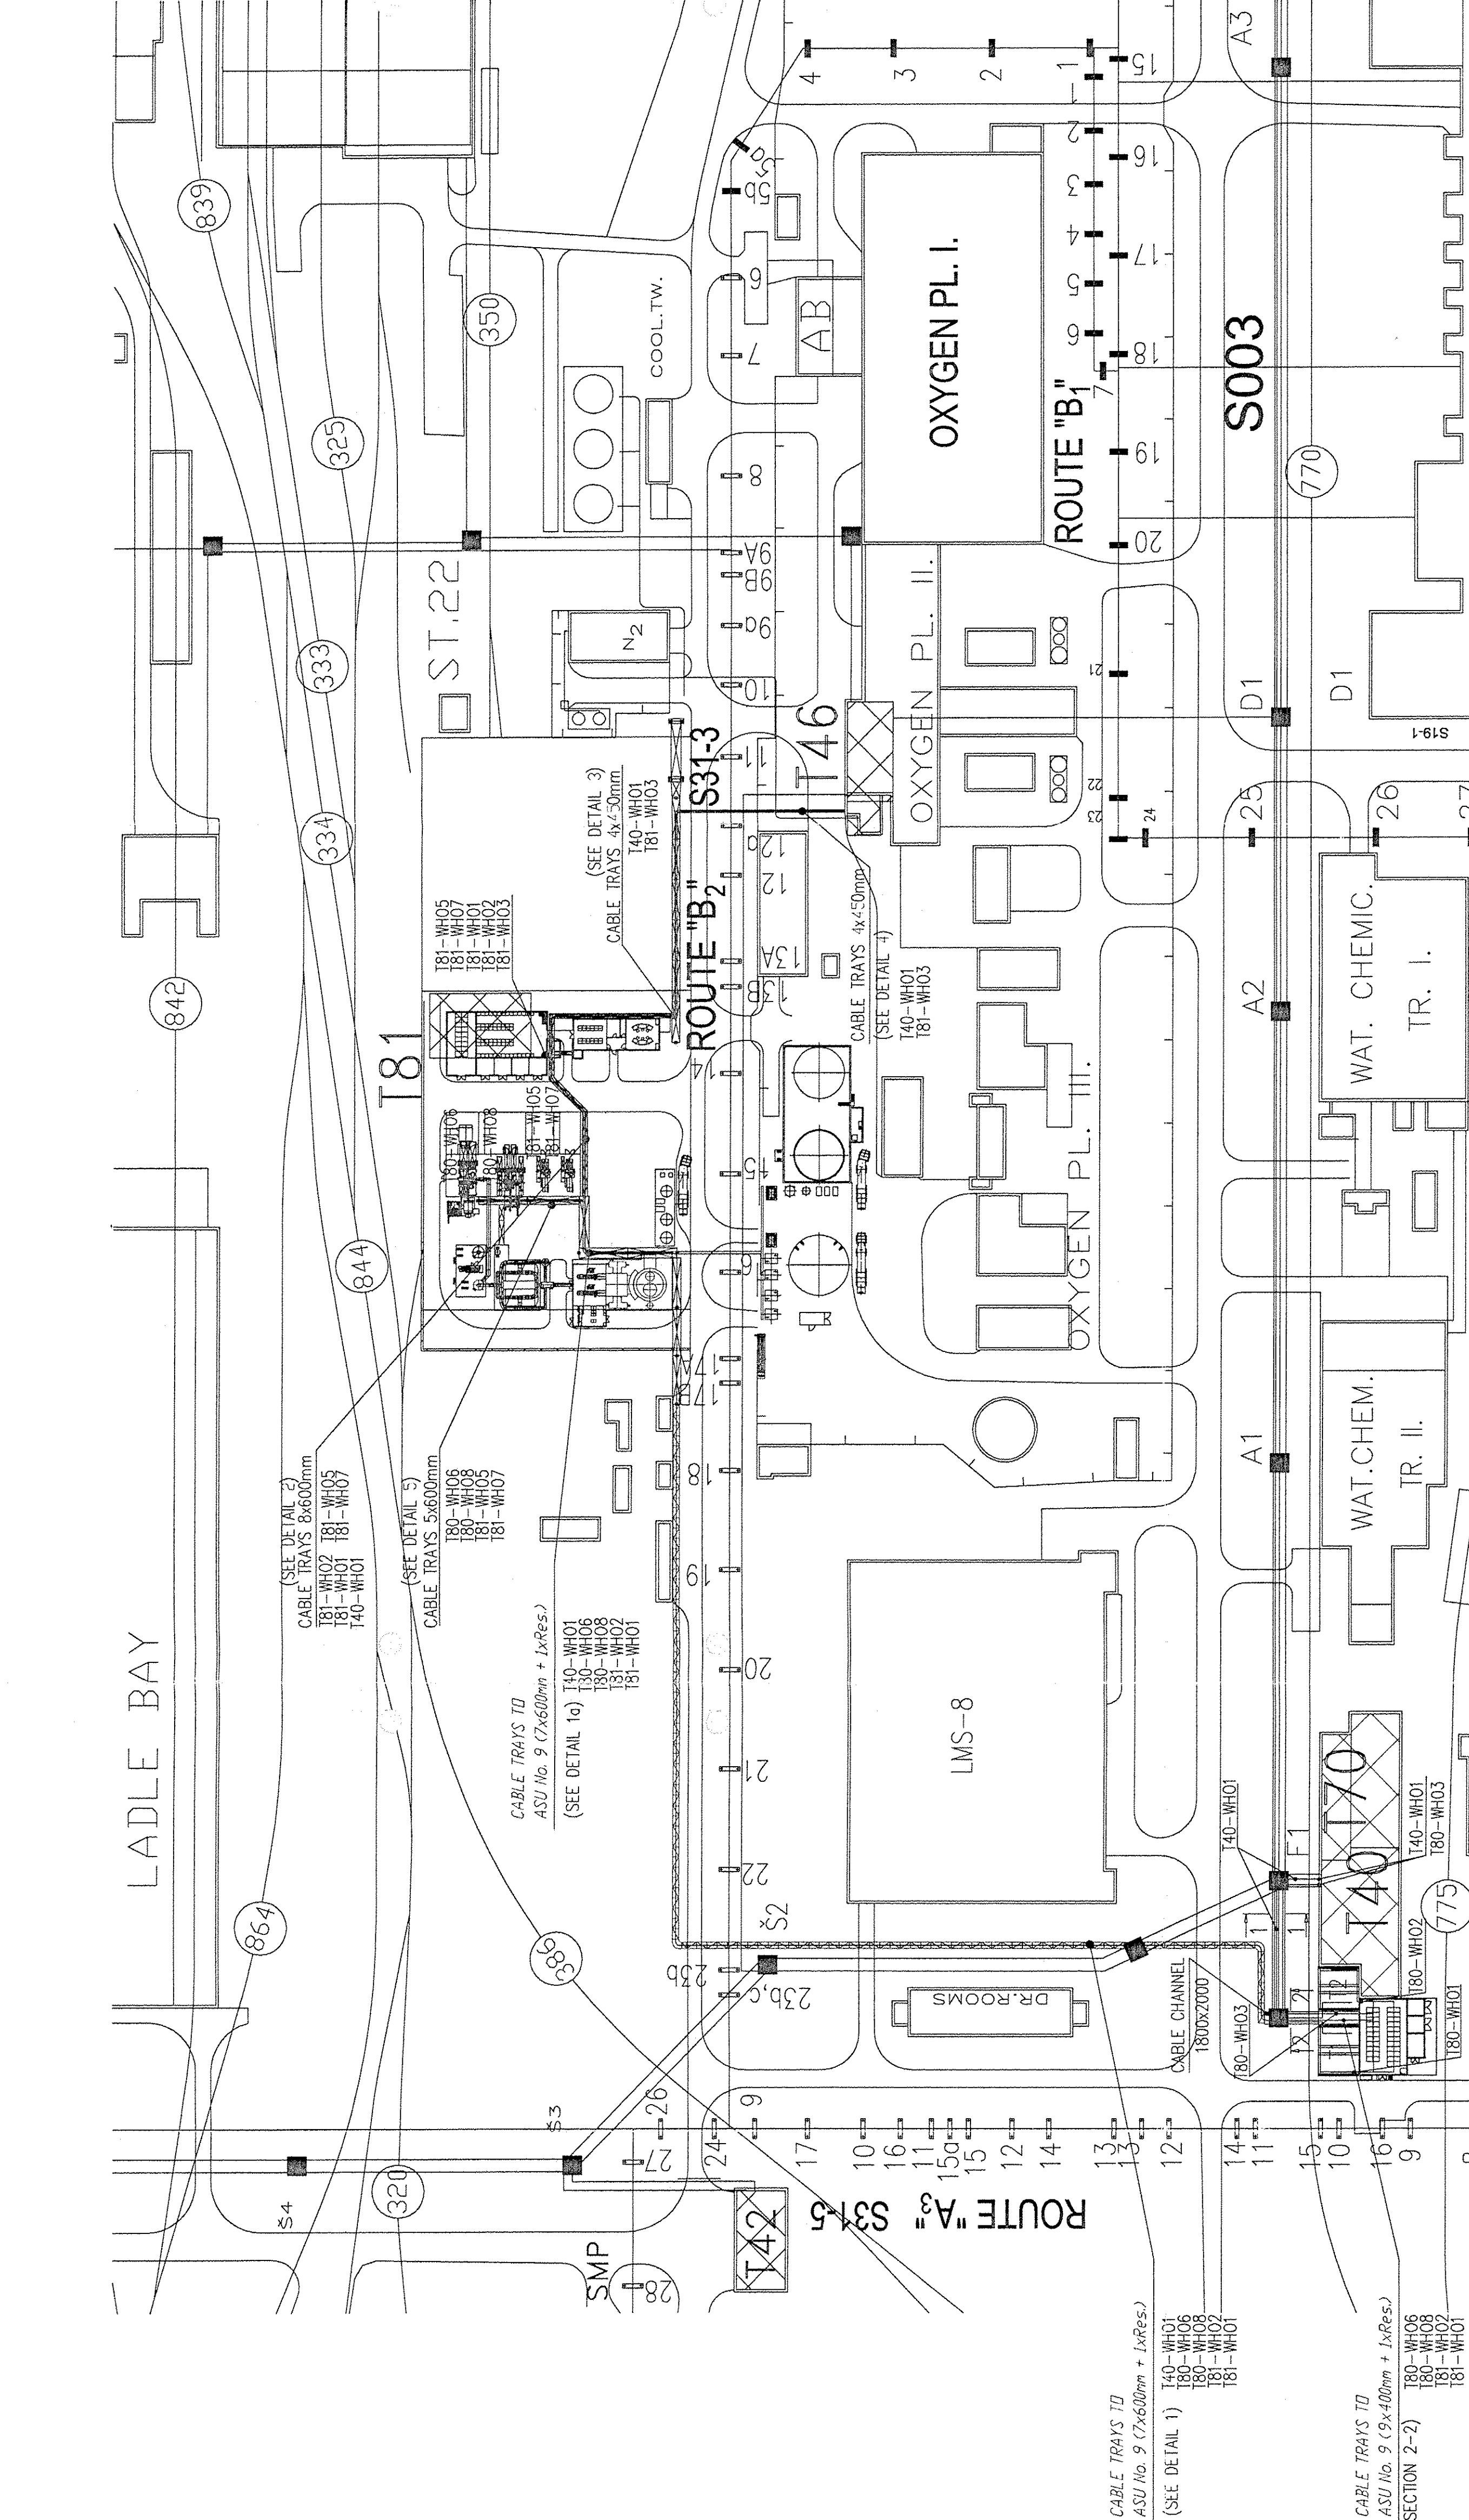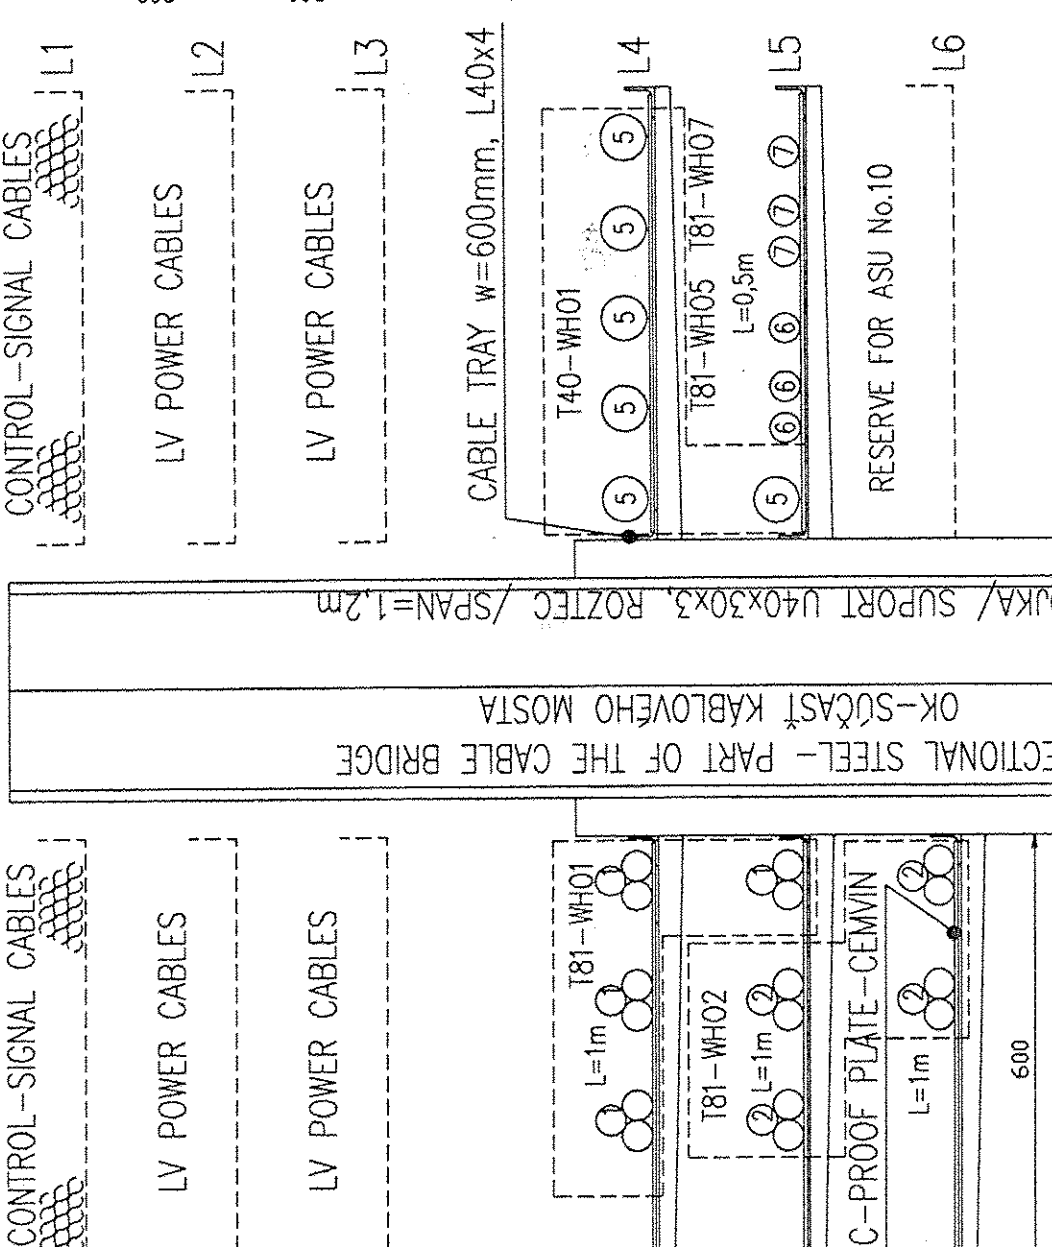


SECTION 1-1 M 1:25
ASSIGNMENT OF CABLE TRAYS
BETWEEN T80 AND T40
BETWEEN T40 AND T46

- T40-WH01 ⑤ - 3.18 - FEED CABLE T40 AND T46 N2xSZY 6x3x240
T80-WH03 ⑨ - 3.3 - FEED CABLE T80 AND T40 N2xSZY 6x3x1500/35

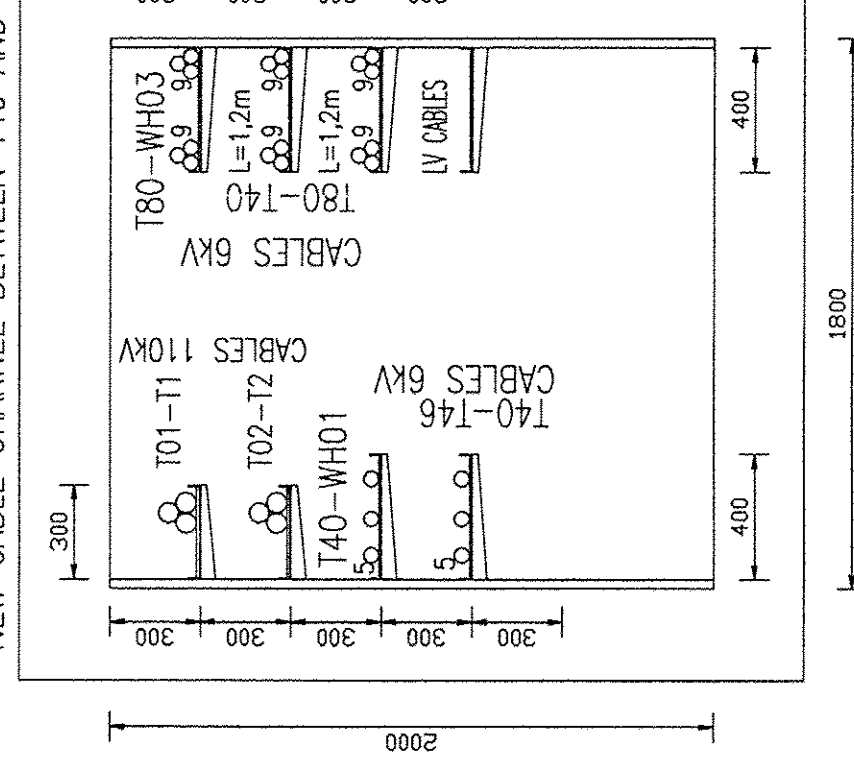


SECTION 2-2 M 1:25
ASSIGNMENT OF CABLE TRAYS
BETWEEN T80 AND T40
BETWEEN T80, T81 AND MOTOR

- T81-WH01 ① - 3.6 - FEED CABLE T81 N2xSZY 4x3x1400/35
T81-WH02 ② - 3.7 - FEED CABLE T81 N2xSZY 4x3x1400/35
T80-WH06 ③ - 3.8 - FEED CABLE MAC MOTOR N2xSZY 2x3x1240/25
T80-WH08 ④ - 3.10 - FEED CABLE BAC MOTOR N2xSZY 2x3x1185/25
T81-WH05 ⑥ - 3.14 - FEED CABLE M70001 N2xSZY 3x1x120/16
T81-WH07 ⑦ - 3.16 - FEED CABLE M77001 N2xSZY 3x1x120/16

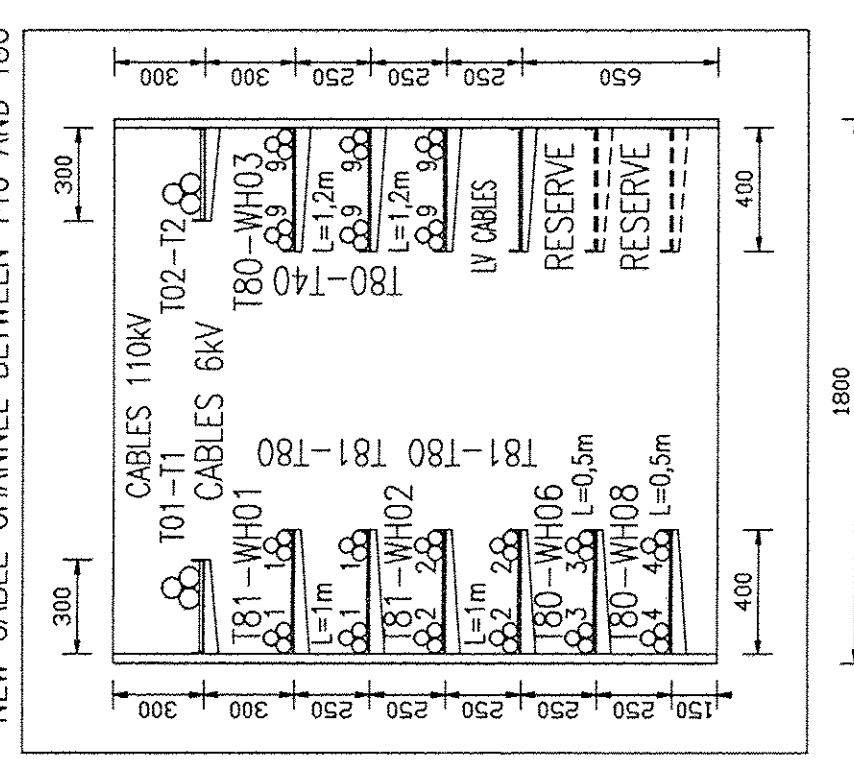


DETAIL 5 M 1:10
ASSIGNMENT OF CABLE TRAYS
BETWEEN T80, T81 AND MOTOR

- T80-WH06 ③ - 3.8 - FEED CABLE MAC MOTOR N2xSZY 2x3x1240/25
T80-WH08 ④ - 3.10 - FEED CABLE BAC MOTOR N2xSZY 2x3x1185/25
T81-WH05 ⑥ - 3.14 - FEED CABLE M70001 N2xSZY 3x1x120/16
T81-WH07 ⑦ - 3.16 - FEED CABLE M77001 N2xSZY 3x1x120/16

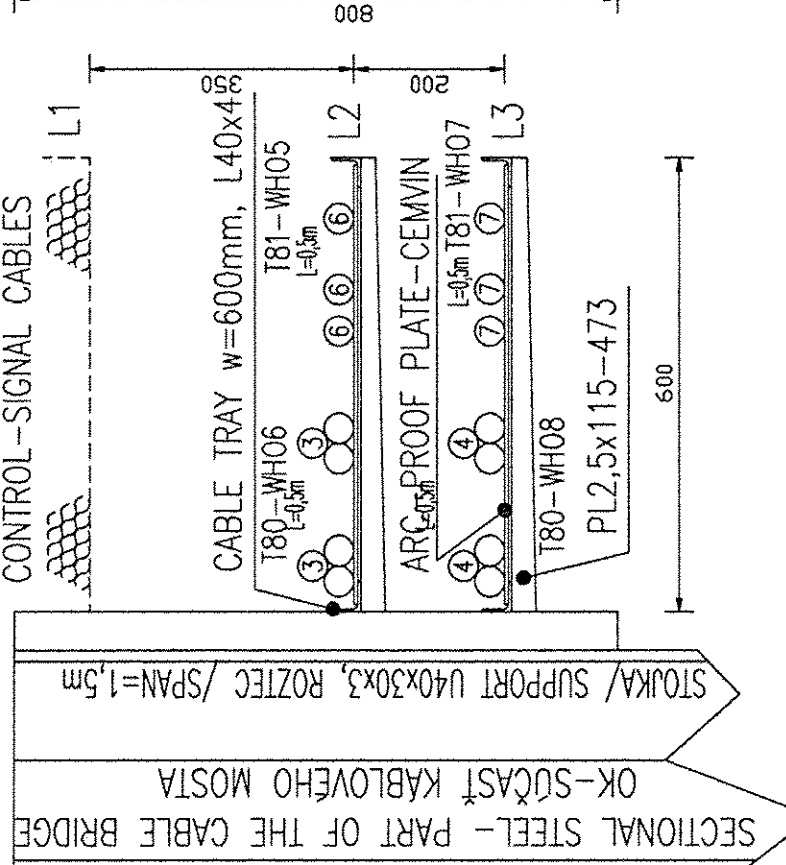

DETAIL 4 M 1:10
ASSIGNMENT OF CABLE TRAYS
BETWEEN T46 AND T81
BETWEEN T40 AND T46

- T40-WH01 ⑤ - 3.18 - FEED CABLE T40 AND T46 N2xSZY 6x3x240
T81-WH03 ⑧ - 3.12 - FEED CABLE T46 AND T81 N2xSZY 4x3x1400/35

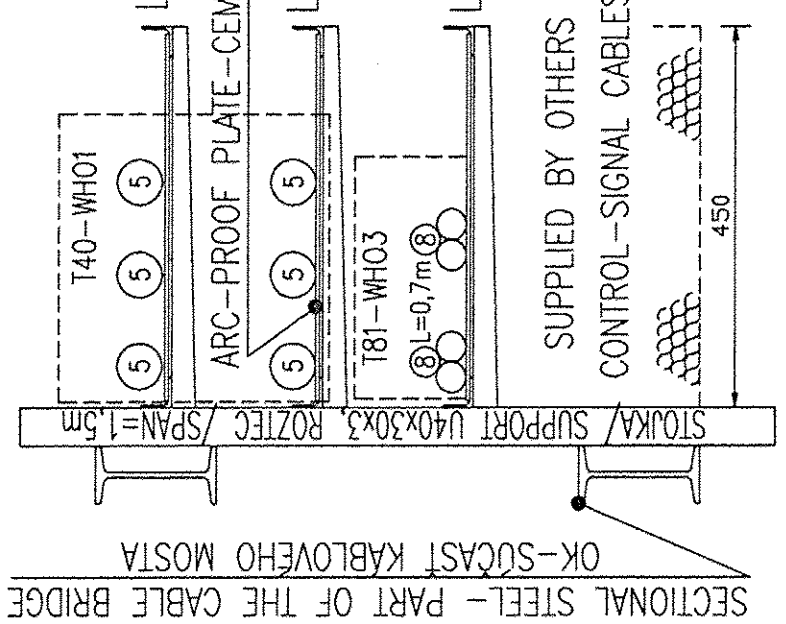

DETAIL 3 M 1:10
ASSIGNMENT OF CABLE TRAYS
BETWEEN T46 AND T81
BETWEEN T40 AND T46

- T40-WH01 ⑤ - 3.18 - FEED CABLE T40 AND T46 N2xSZY 6x3x240
T81-WH03 ⑧ - 3.12 - FEED CABLE T46 AND T81 N2xSZY 4x3x1400/35

